



perfect in sensors.

POSIWIRE®

Cable Extension Position Sensors

WS42

Compact OEM sensor for large order volumes

[Datasheet](#)



Copyright

© ASM GmbH
Am Bleichbach 18-24
85452 Moosinning
Germany

The information presented in this data sheet does not form part of any quotation or contract, is believed to be accurate and reliable and may be changed without notice. No liability will be accepted by ASM for any consequence of its use. Publication thereof does not convey nor imply any license under patent or industrial or intellectual property rights. Applications that are described herein for any of these products are for illustrative purpose only.

ASM makes no representation or warranty that such applications will be suitable for the specified use without further testing or modification.


Analog output	4
Specifications	4
Order code	5
Incremental encoder output	6
Specifications	6
Order code	7
Dimensions	8
Measurement range 750/1000 mm, R1K, mounting brackets	8
Measurement range 750/1000 mm, R1K, spacer nuts	9
Measurement range 1000 mm, IE24, mounting brackets	10
Measurement range 1000 mm, IE24, spacer nuts	11
Output specifications	12
Analog outputs	12
Voltage divider R1K	12
Signal conditioner IE24LI and IE24HI	13
Accessories	15
Mounting bracket WS42 / WS42C	15

Analog output



Compact OEM sensor for large order volumes

- Measurement range up to 1000 mm
- Protection class IP50
- Mounting selectable between mounting brackets or spacer nuts
- Analog output



Specifications

Output	R1K = Potentiometer 1 K Ω
Resolution	Analog: quasi infinite
Linearity	$\pm 0.35\%$ f.s., other values on request
Sensing device	Precision potentiometer
Housing material	Plastic, aluminium measuring cable: stainless steel
Protection class	IP50
Connection	Potentiometer (soldering eye)
Temperature range	-15 ... +60 °C, max. 85 % RH, non condensing
Weight	Approx. 130 g
Pull-out force	750 mm: 2.5 N 1000 mm: 1.7 N
EMC	EN 61326-1:2013

Order code

WS42 - 1 - 2 - 3 - 4

1 Measurement range (in mm)

750 / 1000

2 Output

R1K = Potentiometer 1 KΩ

3 Linearity

L35 = ±0.35%

4 Sensor mounting

1 = Mounting brackets
2 = Spacer nuts

Order example


WS42 - 1000 - R1K - L35 - 1

Incremental encoder output



Compact OEM sensor for large order volumes

- Measurement range up to 1000 mm
- Protection class IP50
- Mounting selectable between mounting brackets or spacer nuts
- Incremental encoder output



Specifications

Output	IE24LI = Incremental encoder TTL compatible IE24HI = Incremental encoder HTL compatible
Resolution	6 pulses / mm (24 edges / mm)
Linearity	±0.20% f.s.
Sensing device	Incremental encoder
Housing material	Plastic, aluminium measuring cable: stainless steel
Protection class	IP50
Connection	Cable output radial, length approx. 3 m
Temperature range	0 ... +60 °C, max. 85 % RH, non condensing
Weight	Approx. 130 g
Pull-out force	1.7 N
EMC	EN 61326-1:2013

Order code

WS42 – 1 – 2 – 3 – 4

1 Measurement range (in mm)

1000

2 Resolution

6 = 6 pulses / mm

3 Output

IE24LI = Incremental encoder TTL compatible

IE24HI = Incremental encoder HTL compatible

4 Mounting

1 = Mounting brackets


2 = Spacer nuts

Order example

WS42 – 1000 – 6 – IE24HI – 1

Dimensions


Measurement range 750/1000 mm, R1K, mounting brackets

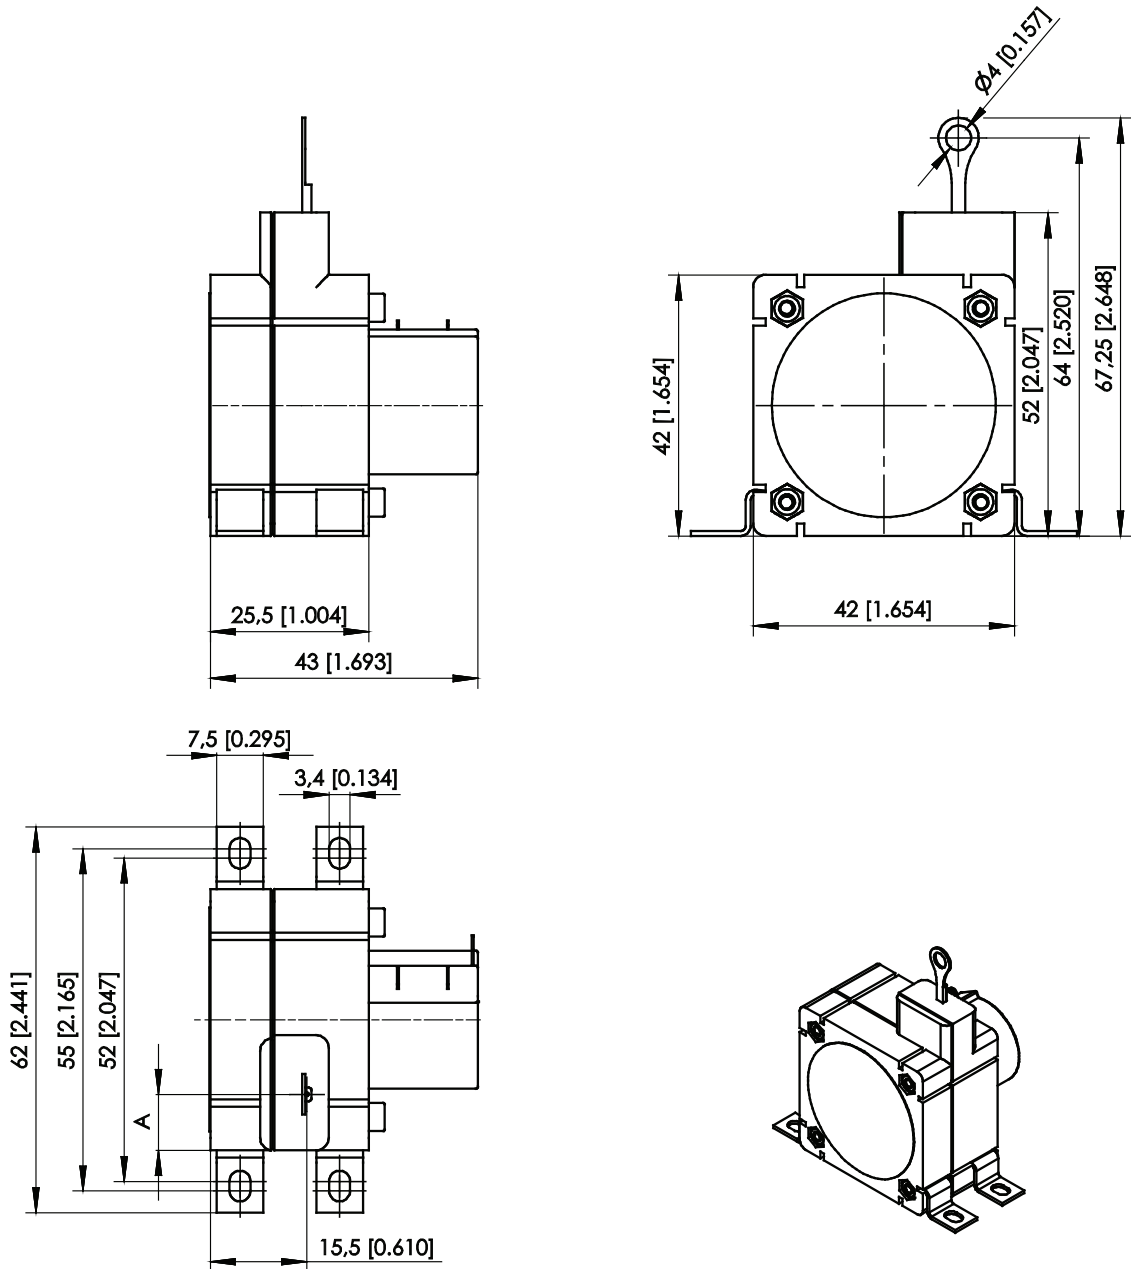

Dimensions in mm [inch]
 Dimensions informative only.
 For guaranteed dimensions consult factory.

Dimensions in mm	Measurement range	A
	750	9
	1000	3.3

Measurement range 750/1000 mm, R1K, spacer nuts

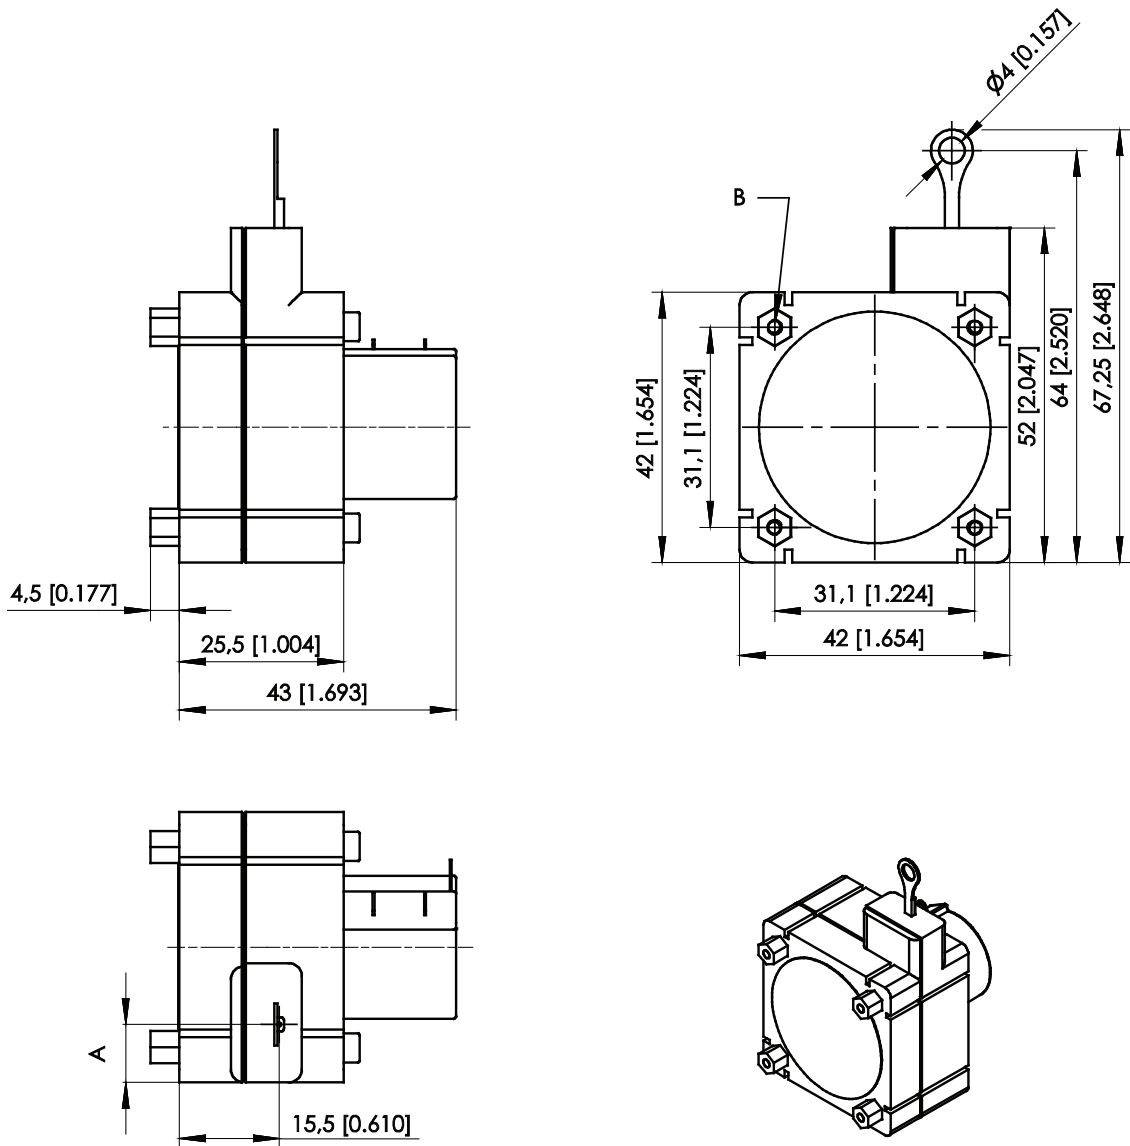


Dimensions in mm	Measurement range	A
	750	9
	1000	3.3

B – M2,5 – 4.5 [.177] deep


Dimensions in mm [inch]
 Dimensions informative only.
 For guaranteed dimensions consult factory.

Measurement range 1000 mm, IE24, mounting brackets

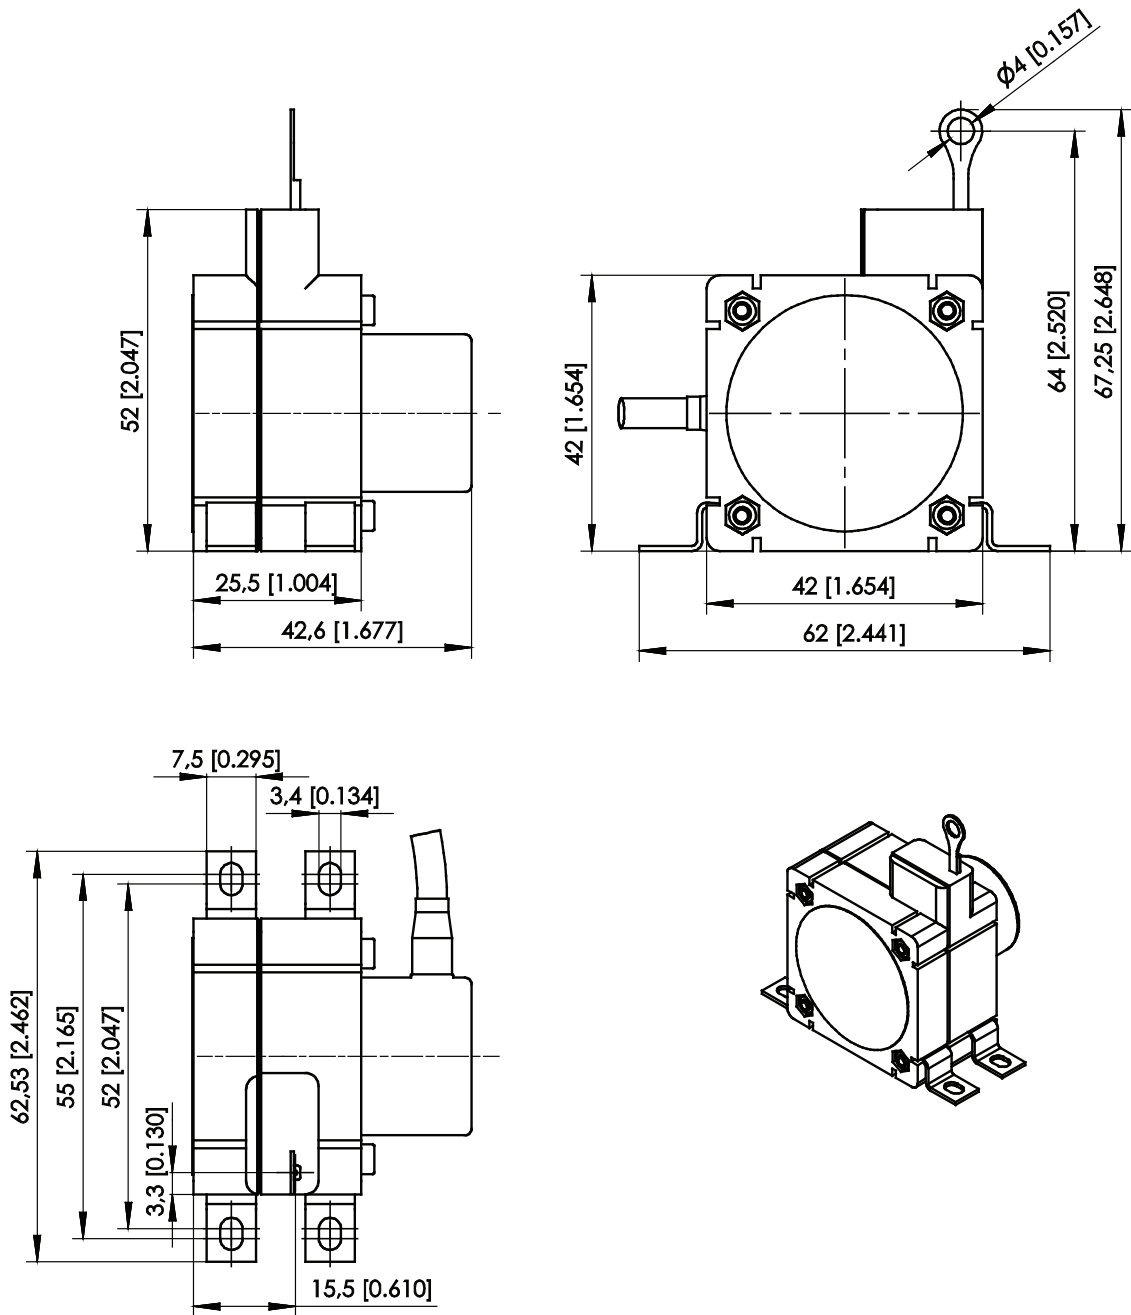

Dimensions in mm [inch]
 Dimensions informative only.
 For guaranteed dimensions consult factory.

Measurement range 1000 mm, IE24, spacer nuts

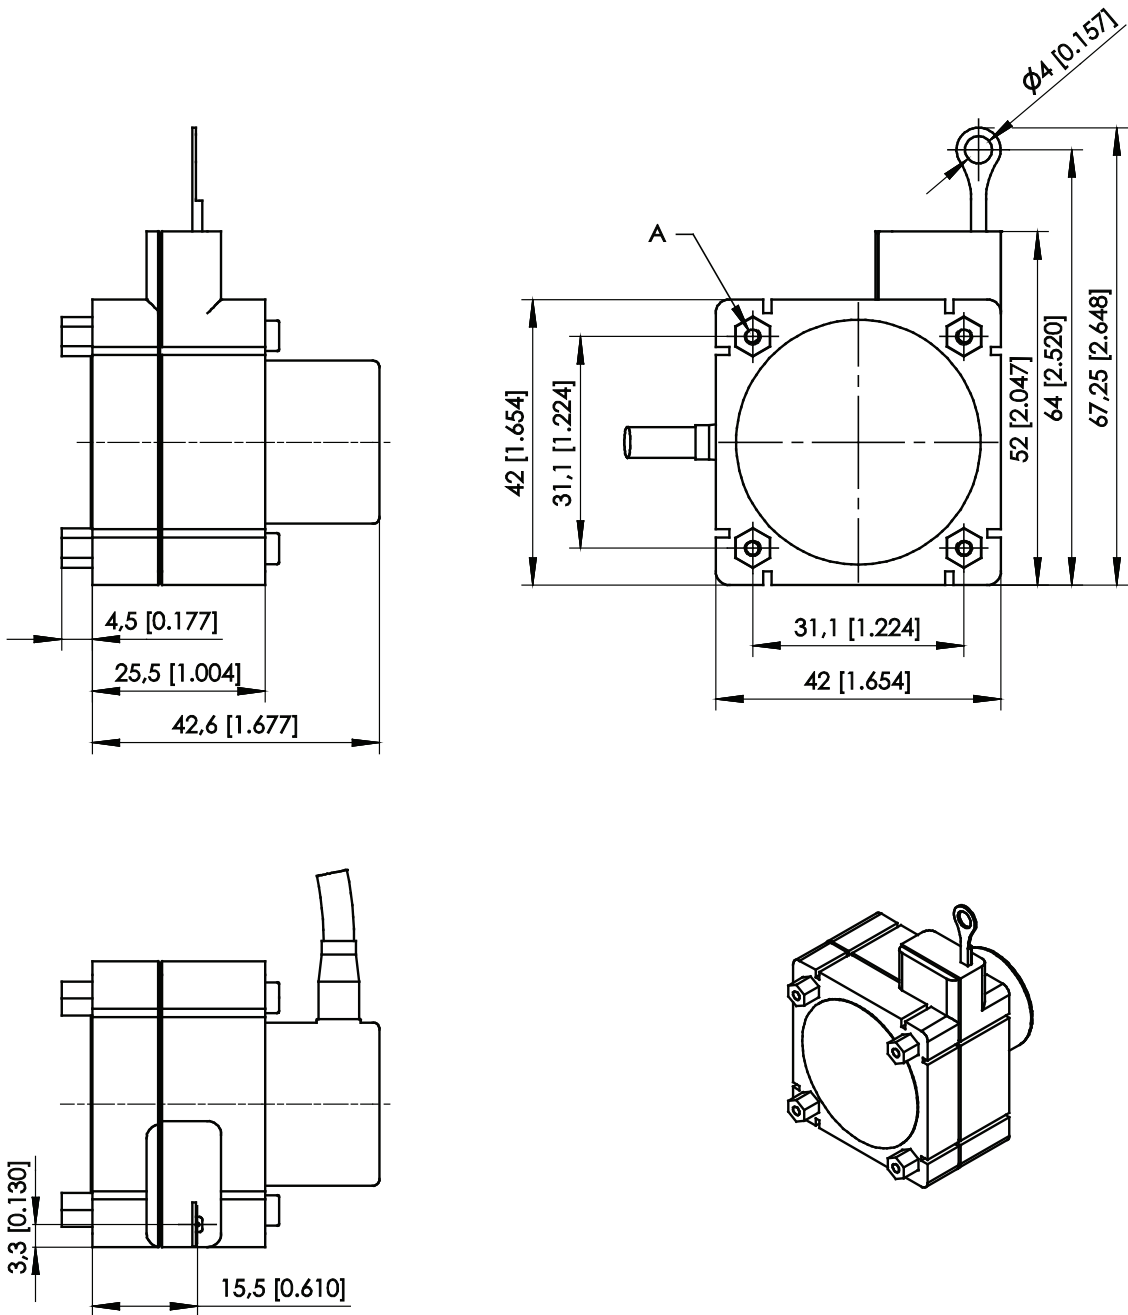


A – M2,5 – 4 [.157] deep

Dimensions in mm [inch]
 Dimensions informative only.
 For guaranteed dimensions consult factory.


Output specifications

Analog outputs

Voltage divider R1K

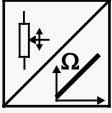Potentiometer 	Excitation voltage	32 V DC max. at 1 kΩ (max. power 1 W)
	Potentiometer impedance	1 kΩ ±10 %
	Thermal coefficient	±25 x 10 ⁻⁶ / °C f.s.
	Sensitivity	Depends on the measuring range, individual sensitivity of the sensor is specified on the label
	Voltage divider utilization range	approx. 3 % ... 97 %
	Operating temperature	Refer to output specification
	EMC	EN 61326-1:2013

Output signals

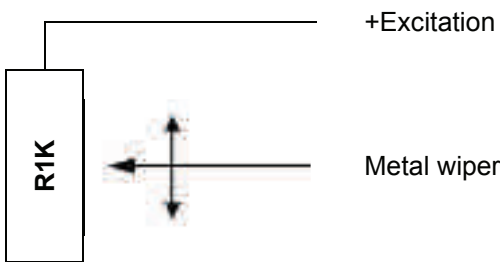

Note:



The metal wiper of the potentiometer must be protected against current load!

Electrical current flow impact on the wiper causes linearity errors and shortens the lifetime of the potentiometer.


See:

http://www.asm-sensor.com/asm/pdf/pro/ws_poti_technote_en.pdf


Signal wiring potentiometer WS31 / WS42

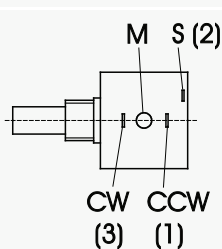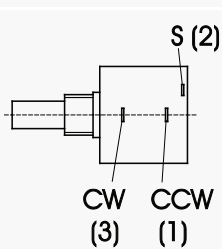Signal	CT-Poti / 5-Turn WS31: 250 mm	Multi-Turn-Poti / 10-Turn WS31, WS42: 500 / 750 / 1000 mm
		
Poti +	M	CCW
Poti GND	CW	CW
Poti slider	S	S


Signal conditioner IE24LI and IE24HI

	IE24LI	IE24HI	
Incremental			
	Excitation voltage	5 V DC ±10 %	10 ... 30 V DC
	Excitation current	100 mA max.	
	Output frequency	200 kHz max.	
	Output	Push-Pull and inverted signals	
	Output current	10 mA max.	
	Output voltage	Depending on the excitation voltage	
	Stability (temperature)	±20 x 10 ⁻⁶ / °C f.s. (sensor mechanism)	
	Operating temperature	Refer to output specification of the sensor	
	Protection	Short circuit	
	EMC	EN 61326-1:2013	

Output signals

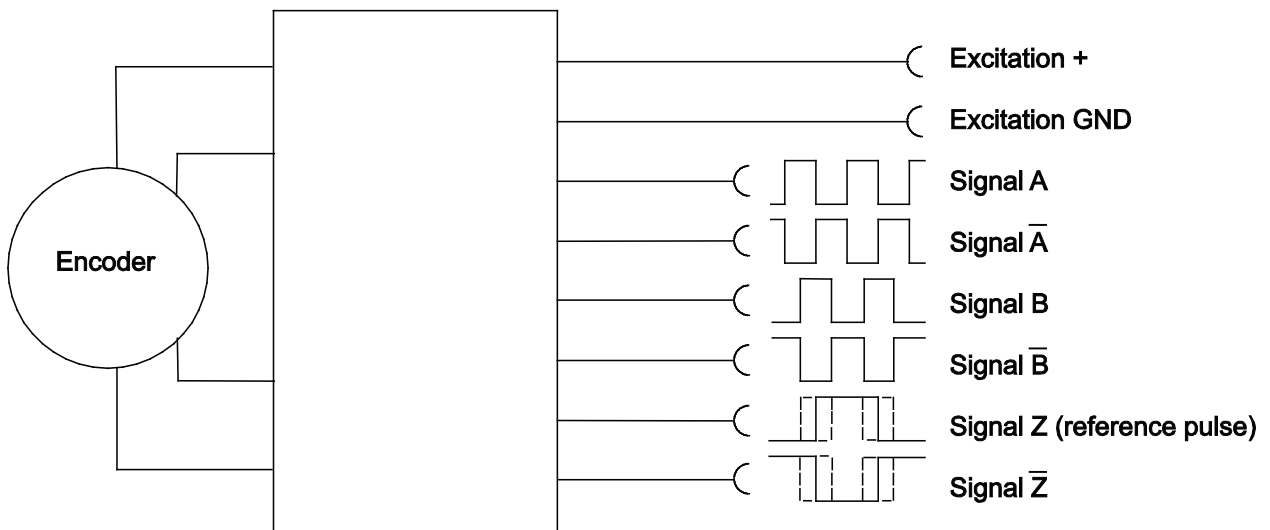

Recommended processing circuit

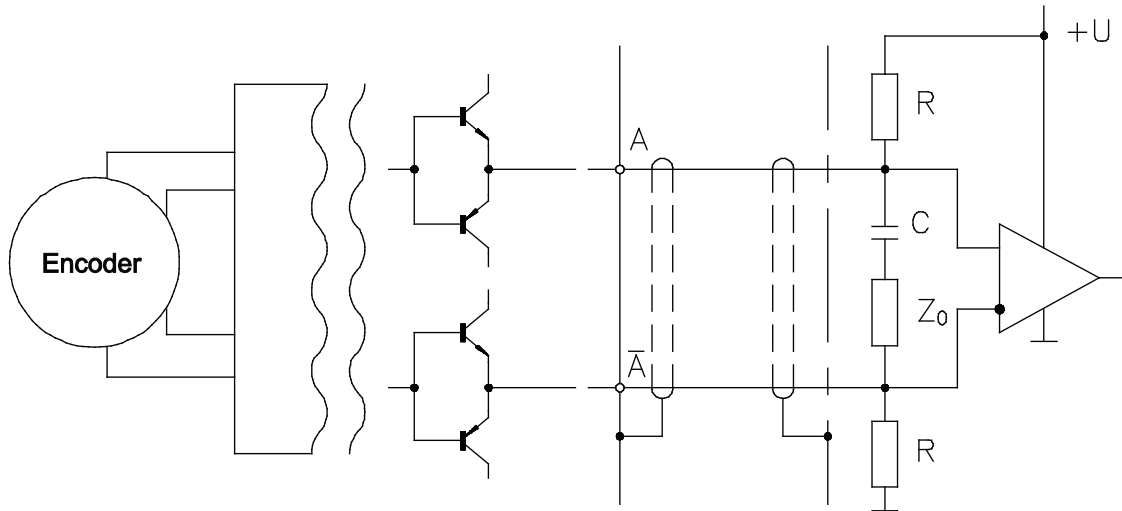

Signal wiring

Signal	Cable color
Excitation +	brown
Excitation GND	white
Signal A	green
Signal \bar{A}	yellow
Signal B (A + 90°)	grey
Signal \bar{B}	pink
Signal Z (reference pulse)	blue
Signal \bar{Z}	red

Accessories

Mounting bracket WS42 / WS42C

(only for sensors with spacer nuts)

Order code **WS42-BFW1**

